Download date: 14.03.2013



ZLIN AIRCRAFT a.s.

Letiště 1578, 765 81 Otrokovice, Czech Republic

e-mail: zlinservice@zlinaircraft.eu http://www.zlinaircraft.eu



MANDATORY SERVICE BULLETIN Z142/53a

Technical content of the document approved on the basis of DOA Approval No. EASA.21J.110

"SAFETY RELATED"

1. DATE: February 15, 2007

2. MODEL AFFECTED: All Z 142 aircraft.

3. SUBJECT: After the AMU1 Acceleration Monitoring Unit has been entered

into operation on ZLIN aircraft of Z42 series, it has been found out that real intensity of acrobatic operation of some aircraft considerably exceeds original expectations that have been used for determination of operation limits. These aircraft exceed determined total limit load spectra and limit design acrobatic

load spectrum.

Described condition can be even worsened by a performance of acrobatic maneuvers in Utility Category. From these reasons, to assure a safety, it is necessary reduce acrobatic maneuvers in Utility Category acc. to FAR Part §23.3 (b)(1) and (b)(2) to: spins, lazy eights, chandelles, and steep turns, or similar maneuvers, in which the angle of bank is more than 60 degrees

but not more than 90 degrees.

4. CORRECTION: Pertinent revision of accompanying technical documentation.

5. TIME OF COMPLIANCE: Immediately after receipt. Of this bulletin.

6. PERFORMED BY: Operator.

7. **COSTS COVERED BY:** No will arise.

8. PROCEDURES: In the Z 142 Flight Manual, Czech version:

- remove old pages: 1-4; 2-5; 2-11; 2-12

- insert new pages of the Revision dated November 24, 2006

(see enclosure)

- note this revision into the Log of Revision

In the Z 142 Flight Manual English version:

- remove old pages: 1-4; 2-5; 2-11; 2-12

- insert new pages of the Revision dated November 24, 2006

(see enclosure)

- note this revision into the Log of Revision

Download date: 14.03.2013

MANDATORY SERVICE BULLETIN Z142/53a

In the Z 142 Flight Manual German version:

- remove old pages: 1-4; 2-11; 2-12
- insert new pages of the Revision dated November 24, 2006 (see enclosure)
- note this revision into the Log of Revision
- **9. NECESSARY MATERIAL:** New pages of accompanying documentation (see enclosure).
- **10. ENCLOSURE:** New pages of the Z 142 Flight Manual, Czech version:

1-4; 2-5; 2-11; 2-12

New pages of the Z 142 Flight Manual, English version:

1-4; 2-5; 2-11; 2-12

New pages of the Z 142 Flight Manual, German version:

1-4; 2-11; 2-12

SIGNED:

Dušan Totek Chief Designer

Contact address: ZLIN AIRCRAFT a.s.

ZLIN Service 765 81 Otrokovice Czech Republic