



ZLIN AIRCRAFT a.s.
Letiště 1578, 765 81 Otrokovice,
Czech Republic
e-mail: zlinservice@zlinaircraft.eu
http://www.zlinaircraft.eu

MANDATORY

**SERVICE
BULLETIN**

MANDATORY SERVICE BULLETIN Z 242L/8a

1. **CONCERN :** The Z 242L aircraft, S/N 541, 651 up to 0659.
2. **REASON :** Cracks occurrence and breaking - off the elastic strip which attaches the flexible control rod of the propeller governor.
3. **MEASURES :** Replacement of the original one elastic strip by the couple of new ones on flexible rod attachment of the throttle, mixture and propeller governor controls - see appendix. Pay increased attention to this attachment during Scheduled Inspections.
4. **MEASURES SHALL BE PERFORMED :**
Immediately after bulletin receipt.
5. **PERFORMER :** The user.
6. **EXPENSES WILL BE COVERED :**
The aircraft manufacturer ensures the parts manufacture and delivery.
7. **NECESSARY MATERIAL :**
6 pcs of the elastic strip 153.0.650-012 - will be delivered enclosed to this bulletin by the aircraft manufacturer.
8. **PROCEDURE :** Mark the original position of the clamp on the flexible control rod tube. Install new strips and fasten the control rod tube by the clamp in original position.
9. **THE BULLETIN BECOMES EFFECTIVE WITHIN 30 DAYS AFTER THE DATE OF CAI APPROVAL.**
10. **APPENDIX :** Drawing of the throttle control, the mixture control and the propeller governor control.

Antonín Partika
.....
Manufacturer's
Representative

Jan Beneš
.....
CAI Representative

26.4.1994
.....
Date

